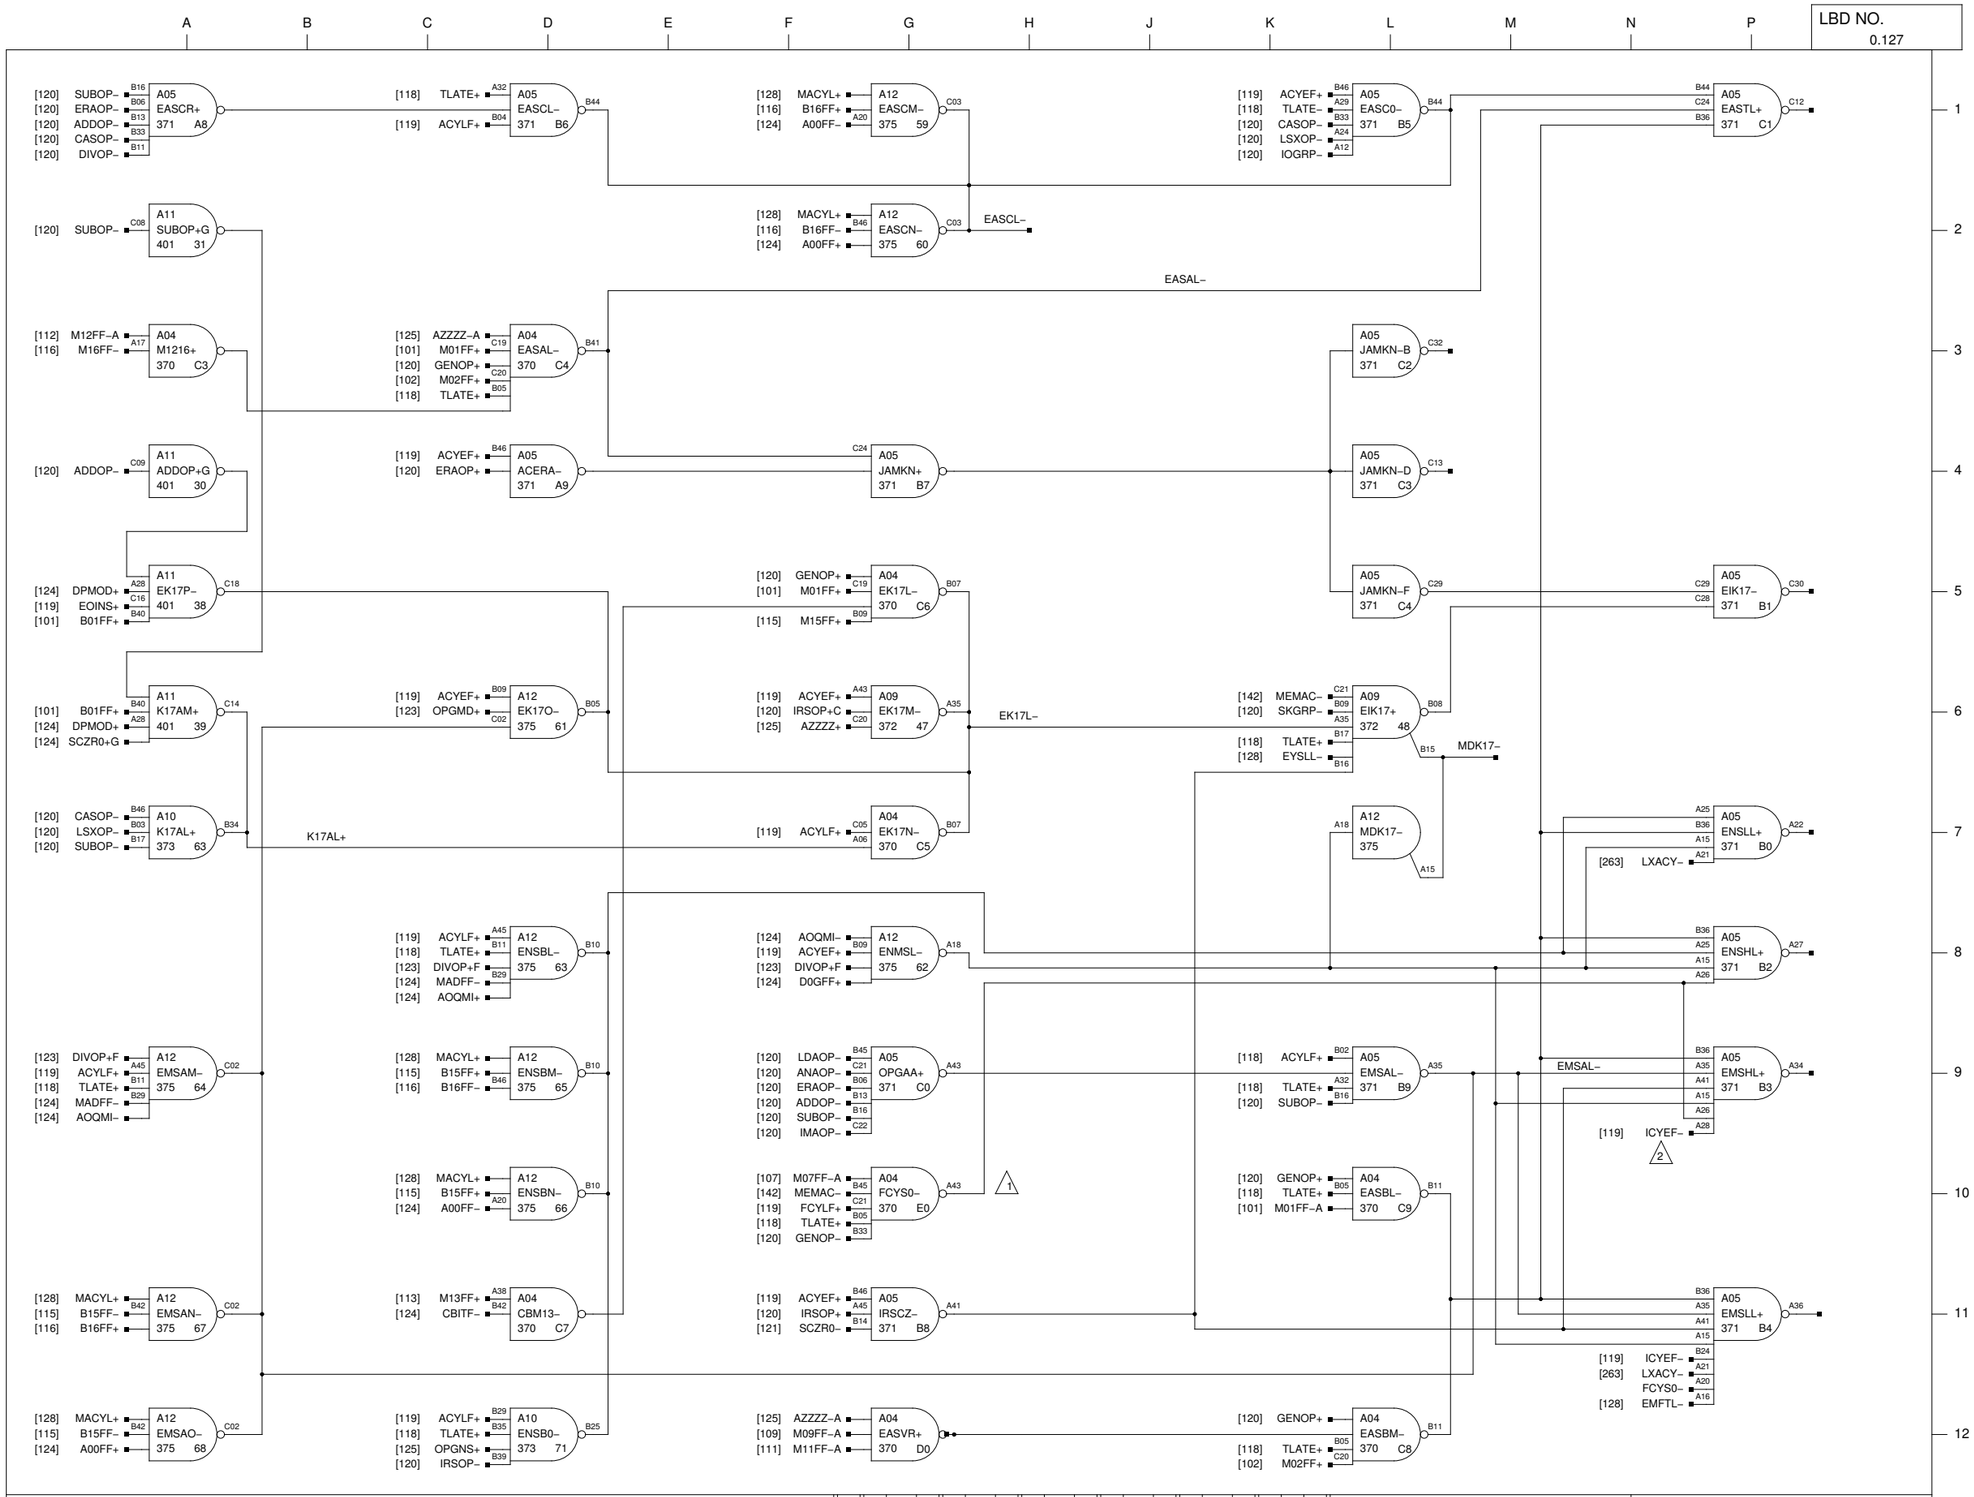
LBD NO.
0.127
A05 EASCR+ 371 A8
A05 EASCL− 371 B6
A12 EASCM− 375 59
A12 EASCN− 375 60
A05 EASC0− 371 B5
A05 EASTL+ 371 C1
A11 SUBOP+G 401 31
A04 M1216+ 370 C3
A04 EASAL− 370 C4
A05 JAMKN−B 371 C2
A05 ACERA− 371 A9
A05 JAMKN+ 371 B7
A05 JAMKN−D 371 C3
A11 ADDOP+G 401 30
A11 EK17P− 401 38
A04 EK17L− 370 C6
A05 JAMKN−F 371 C4
A05 EIK17− 371 B1
A11 K17AM+ 401 39
A12 EK17O− 375 61
A09 EK17M− 372 47
A09 EIK17+ 372 48
A10 K17AL+ 373 63
A04 EK17N− 370 C5
A12 MDK17− 375
A05 ENSLL+ 371 B0
A12 ENSBL− 375 63
A12 ENMSL− 375 62
A05 ENSHL+ 371 B2
A12 EMSAM− 375 64
A12 ENSBM− 375 65
A05 OPGAA+ 371 C0
A05 EMSAL− 371 B9
A05 EMSHL+ 371 B3
A12 ENSBN− 375 66
A04 FCYS0− 370 E0
A04 EASBL− 370 C9
A12 EMSAN− 375 67
A04 CBM13− 370 C7
A05 IRSCZ− 371 B8
A05 EMSLL+ 371 B4
A12 EMSAO− 375 68
A10 ENSB0− 373 71
A04 EASVR+ 370 D0
A04 EASBM− 370 C8
K17AL+
EASCL−
EASAL−
EK17L−
MDK17−
EMSAL−
NOTES:
1 IF MEMORY LOCKOUT OPTION (316−08) IS INSTALLED DELETE FCYSO− FROM A1AA0526
2 IF MEMORY LOCKOUT OPTION (316−08) IS INSTALLED SIGNAL ICYEF− ATA1AA0528 IS REPLACED WITH ICYS1−
REVISIONS
REV.
CHK.
A
S. R. 54−3585
B
1/19/70
ECO 7748
EXT CHANGES SEE ECO T.A.
HONEYWELL
INC
COMPUTER CONTROL DIVISION
Old Connecticut Path, Framingham, Mass
DR. D. HAMEL
ENG. K. IZBICKI
APP.
PROJECT NO. 55202
DATE
12−31−1968
7−9−69
TITLE
H−316
CONTROL LOGIC
SIZE C
DWG NO. 70024511
REV. B